



the **play inspection** company

Annual Inspection

Bentley Parish Council

Bentley Recreation Ground

School Lane , GU10 5JP



API Associate



Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t- 01202 590675 e- info@playinspections.co.uk

[www. playinspections .co.uk](http://www.playinspections.co.uk)



Inspection Scope for RPII Annual Inspectors

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Indoor and Outdoor Annual Inspectors (where relevant) on the RPII Register of Inspectors when undertaking inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

For the avoidance of doubt, references to compliance relate only to those aspects that can be assessed visually or manually, within the limitations of a non-dismantling, non-destructive inspection, and without the use of specialist equipment.

The following standards define the technical framework within which inspections are carried out; not all requirements within these standards can be verified during an inspection. The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report; any comments will be made using the principles of BS EN 1176 as guidance only, rather than as a formal assessment of compliance.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to EN 1176. We have not assessed these against the requirements of EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism. Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a basic manual stability check appropriate to a visual

inspection and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. For the purposes of this inspection, “reasonably accessible” means accessible without the use of specialist access equipment, tools, or unsafe working practices. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector’s knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a ‘design risk assessment’ provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a ‘suitable and sufficient assessment’ of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

Responsibility of the Owner/Operator The owner/operator has overall responsibility for the safety, management, and ongoing maintenance of the play equipment and surrounding area. This includes ensuring that equipment is appropriately installed, inspected, maintained, repaired, and managed in accordance with the relevant standards, manufacturer guidance, and applicable legislation

Inspections undertaken by RPII Annual Inspectors contribute to the owner/operator’s discharge of these responsibilities but do not replace the requirement for the owner/operator to carry out suitable and sufficient risk assessments, routine monitoring, and maintenance, or to act on identified defects and recommendations. Responsibility for initiating or undertaking any actions arising from this report rests solely with the Client.

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Inclusion or exclusion within this table does not imply an exhaustive assessment; all inspections and checks are subject to the limitations described within this methodology. Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall inspection responsibilities as detailed in the relevant standards. RPII Annual Inspectors may, where readily available, refer to manufacturer installation instructions for general context, but do not check against these in full on any item as inspections are focused on compliance with relevant standards and maintenance defects; the responsibility for ensuring that installation instructions are adhered to lies with the owner and the installer.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
				No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
				Severity>>				
Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3). Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.								

Bentley Recreation Ground

Inspection Ref: 3188367

Site Ref: 52665

Inspected: 28-August-2026 - 14:22 by James Pyke (RPII Annual inspector)

Risk Assessment: **20 High Risk**

**Location:**

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features - The area includes limited accessible elements; however, aspects of the layout, surfacing, or equipment may present barriers to use for some people with disabilities without reasonable adjustments or assistance.

6 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 3



Finding 1

There is some tree debris on the surfacing - Remove and maintain

Finding 3

NOTE - The client was made aware of any findings with a risk score of 15 and above at the time of the inspection, due to the urgency of action required. - Ensure appropriate action is, or has already been taken.

Finding 2

There is weed / vegetation growth within the surface - Remove weed / vegetation growth

4 - Very Low Risk

Item: Sign
Manufacturer: Not Identified
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Gate - Self Closing
Manufacturer: Easy Gate Ltd
Surface Type: Concrete
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

The gate is closing too quickly (less than 4 seconds) - Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

Finding 2

The paint is flaking off the metalwork - Rub down and re-paint

i 8 - Low Risk

Item: Gate - Self Closing
Manufacturer: Easy Gate Ltd
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

The gate is closing too quickly (less than 4 seconds) - Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

 8 - Low Risk

Item: Fencing - Timber
Manufacturer: Jacksons Fencing
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 3



Finding 1

There are a number of loose posts around the fence -
 Monitor for any further deterioration and reset as required

Finding 3

There are areas or parts of the timber posts that have rotted
 - Replace all affected timbers

Finding 2

There is or are fixings missing on the item - Replace all
 missing fixings

 4 - Very Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

6 - Low Risk

Item: Picnic Table
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

The surface has eroded and the foundations are exposed - Reinstate surrounding surfaces to cover the foundations

Finding 2

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

4 - Very Low Risk

Item: Litter Bin
Manufacturer: Glasdon
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Stand up SeeSaw
Manufacturer: Eibe Play Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 2



Finding 1

A number of fixing(s) have worked loose - Secure all loose fixings

Finding 2

The surface has subsided around the tyre dampeners - Monitor for any further deterioration and repair as required

i 4 - Very Low Risk

Item: Play Panel
Manufacturer: Eibe Play Ltd
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Basket Swing - Type 1
Manufacturer: Eibe Play Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 6

Finding 1

The seat connection cannot be inspected fully as the chain cover cannot be lifted - Cut the cover to allow access to the shackle and assess the wear

Finding 2

The bush / bushes is / are showing signs of wear - Monitor for any further deterioration and replace as required

Finding 3

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 4

The seat has minor damage or wear - Monitor for any further deterioration and replace as required

Finding 5

The grass mats are silted up, the soil is compacted and the area will become very slippery when the soil is wet. - Reinstate as required

Finding 6

There are gaps opening between the grass mat tiles - Provide additional ties or secure / reinstate surface

i 6 - Low Risk

Item: Play Panel
Manufacturer: Eibe Play Ltd
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

The item has been damaged - Monitor for any further deterioration and replace as required

i 10 - Low Risk

Item: Multi Play (Junior)
Manufacturer: Eibe Play Ltd
Surface Type: Bonded Rubber Mulch
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 10



Finding 1

The use of synthetic fillers in timber is not recommended; timber being a natural material will expand and contract as the moisture content changes and the use of fillers can exacerbate the length and depth of these cracks or shakes in the timber. The only treatment that is normally required is the removal of any rough or sharp edges unless the structural integrity of the item is affected. - Remove any rough or sharp edges and monitor timber for any further deterioration

Finding 3

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process. Timber splits may also create rough / splintering edges. - Monitor, sand down any rough edges and ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 5

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

Finding 7

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 9

A number of fixing(s) have worked loose on the guarding - Secure all loose fixings

Finding 2

A number of fixing(s) have worked loose - Secure all loose fixings

Finding 4

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

Finding 6

A number of fixing(s) have worked loose - Secure all loose fixings

Finding 8

There is some graffiti present - Remove the graffiti

Finding 10

There is/are finger entrapment/s in the platform and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No action given the risk assessment

 6 - Low Risk

Item: Musical Instrument
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

The area around the item has eroded and may become slippery - Reinststate eroded area

 6 - Low Risk

Item: 1 Bay 2 Seat (Cradle)
Manufacturer: Eibe Play Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There is some wear to the shackles. - Monitor for any further deterioration and replace when 40% worn

4 - Very Low Risk

Item: Multi Play (Toddler)
Manufacturer: Not Identified
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

8 - Low Risk

Item: Crawling Tunnel
Manufacturer: Eibe Play Ltd
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 4



Finding 1

This design / configuration of tunnel mound is well established and has been successfully included in large quantities of playgrounds throughout the UK. Whilst the design does not fully meet the requirements of BS EN 1176 with regards to falls in excess of 600mm over the edge of the tunnel to the surface below, it has been risk assessed as fit for purpose in this regard and no changes are recommended to the design unless otherwise stated in additional findings - Monitor - No action given the risk assessment

Finding 3

There are projecting grass mat pins present - Remove and provide more appropriate fixings if required

Finding 2

The grass has eroded within the impact area of the equipment and may not provide the necessary impact attenuating properties for the equipment fall height; the surface may also be slippery in wet weather - Reinstate the grass or provide an all weather surface

Finding 4

There is some evidence of fire damage to the item - Monitor for any further deterioration and repair as required

 12 - Moderate Risk

Item: Tree Trunk
Manufacturer: Natural Feature
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

The item has been removed leaving the foundations exposed - Remove the foundations and reinstate surface

Finding 2

There are areas or parts of the timber on the structure that have rotted - Replace all affected timbers

 10 - Low Risk

Item: Embankment Slide
Manufacturer: Eibe Play Ltd
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 3



Finding 1

The surface has eroded and the foundations are exposed - Reinstate surrounding surfaces to cover the foundations

Finding 2

There is moderate damage to the surface - Repair the damaged areas of surfacing

Finding 3

The grass mat surfacing has numerous stones present within the surface and will not perform as intended in relation to Head Injury Criterion testing - Lift mats and ensure stones are removed and ground is suitable prior to re-laying

! 20 - High Risk

Item: Cable Runway
Manufacturer: A.E.Evans
Surface Type: Bonded Rubber Mulch
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 7



Finding 1

We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment - Inspect in accordance with the manufacturers recommendations

Finding 3

The seat is less than 2.0 metres from the post when extended at 45 degrees at the end of the area of travel and does not meet the requirements of BS EN 1176 Part 4 - Adjust the cable stop position to ensure the minimum distance is maintained

Finding 5

The seat connection cannot be inspected without dismantling the seat - Dismantle the seat to inspect the seat connection for wear

Finding 7

The unit is easily accessible and should have the appropriate barriers installed to meet the requirements of BS EN 1176 Part 1 as the height of the unit exceeds 600mm - Monitor - No action given the risk assessment

Finding 2

The item has been severely damaged - Repair or replace the item / affected part

Finding 4

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 6

The grass has eroded within the impact area of the equipment and may not provide the necessary impact attenuating properties for the equipment fall height; the surface may also be slippery in wet weather - Reinststate the grass or provide an all weather surface

Findings information

6 - Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is some tree debris on the surfacing

Action: Remove and maintain

i 6 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is weed / vegetation growth within the surface

Action: Remove weed / vegetation growth

i 0 - Risk Assessment not Undertaken (Finding 3)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: N - Risk Assessment not Undertaken
Surface: N/A



Finding: NOTE - The client was made aware of any findings with a risk score of 15 and above at the time of the inspection, due to the urgency of action required.

Action: Ensure appropriate action is, or has already been taken.

i 8 - Low Risk (Finding 1)

Item: Gates - Gate - Self Closing
Manufacturer: Easy Gate Ltd

Risk Level: L - Low Risk
Surface: Concrete



Finding: The gate is closing too quickly (less than 4 seconds)

Action: Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

i 6 - Low Risk (Finding 2)

Item: Gates - Gate - Self Closing
Manufacturer: Easy Gate Ltd

Risk Level: L - Low Risk
Surface: Concrete



Finding: The paint is flaking off the metalwork

Action: Rub down and re-paint

i 8 - Low Risk (Finding 1)

Item: Gates - Gate - Self Closing
Manufacturer: Easy Gate Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: The gate is closing too quickly (less than 4 seconds)

Action: Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

i 6 - Low Risk (Finding 1)

Item: Fences - Fencing - Timber
Manufacturer: Jacksons Fencing

Risk Level: L - Low Risk
Surface: Grass



Finding: There are a number of loose posts around the fence

Action: Monitor for any further deterioration and reset as required

i 8 - Low Risk (Finding 2)

Item: Fences - Fencing - Timber
Manufacturer: Jacksons Fencing

Risk Level: L - Low Risk
Surface: Grass



Finding: There is or are fixings missing on the item

Action: Replace all missing fixings

i 8 - Low Risk (Finding 3)

Item: Fences - Fencing - Timber
Manufacturer: Jacksons Fencing

Risk Level: L - Low Risk
Surface: Grass



Finding: There are areas or parts of the timber posts that have rotted

Action: Replace all affected timbers

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Picnic Table
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass




Finding: The surface has eroded and the foundations are exposed

Action: Reinstate surrounding surfaces to cover the foundations

i 6 - Low Risk (Finding 2)

Item: Ancillary Items - Picnic Table
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass

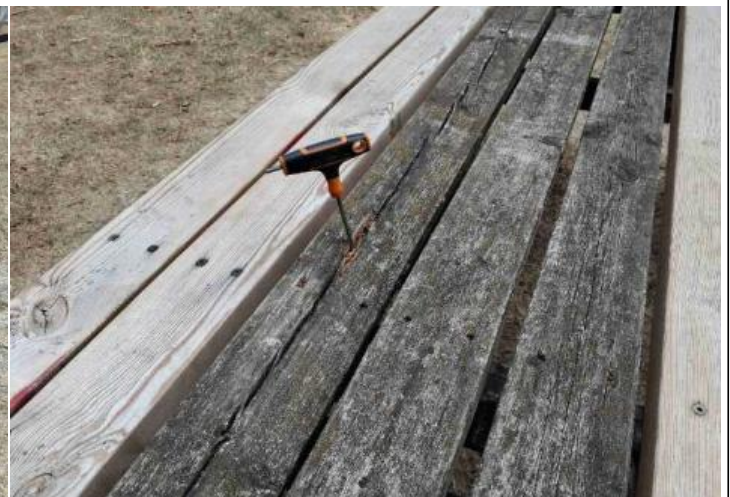

Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 1)

Item: Rocking Equipment - Stand up SeeSaw
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 6 - Low Risk (Finding 2)

Item: Rocking Equipment - Stand up SeeSaw
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The surface has subsided around the tyre dampeners

Action: Monitor for any further deterioration and repair as required

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Grass Matrix Tiles



Finding: The seat connection cannot be inspected fully as the chain cover cannot be lifted

Action: Cut the cover to allow access to the shackle and assess the wear

i 4 - Very Low Risk (Finding 2)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: The bush / bushes is / are showing signs of wear

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 3)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 6 - Low Risk (Finding 4)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The seat has minor damage or wear

Action: Monitor for any further deterioration and replace as required

i 8 - Low Risk (Finding 5)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The grass mats are silted up, the soil is compacted and the area will become very slippery when the soil is wet. **Action:** Reinstate as required

i 8 - Low Risk (Finding 6)

Item: Swings - Basket Swing - Type 1
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There are gaps opening between the grass mat tiles **Action:** Provide additional ties or secure / reinstate surface

 6 - Low Risk (Finding 1)			
Item: Activity Equipment - Play Panel		Risk Level: L - Low Risk	
Manufacturer: Eibe Play Ltd		Surface: Grass	
			
Finding: The item has been damaged		Action: Monitor for any further deterioration and replace as required	

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The use of synthetic fillers in timber is not recommended; timber being a natural material will expand and contract as the moisture content changes and the use of fillers can exacerbate the length and depth of these cracks or shakes in the timber. The only treatment that is normally required is the removal of any rough or sharp edges unless the structural integrity of the item is affected.

Action: Remove any rough or sharp edges and monitor timber for any further deterioration

i 6 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 6 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process. Timber splits may also create rough / splintering edges.

Action: Monitor, sand down any rough edges and ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 4 - Very Low Risk (Finding 4)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 5)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

i 8 - Low Risk (Finding 6)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 6 - Low Risk (Finding 7)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 0 - Risk Assessment not Undertaken (Finding 8)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Bonded Rubber Mulch



Finding: There is some graffiti present

Action: Remove the graffiti

i 10 - Low Risk (Finding 9)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: A number of fixing(s) have worked loose on the guarding

Action: Secure all loose fixings

i 5 - Very Low Risk (Finding 10)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Eibe Play Ltd

Risk Level: V - Very Low Risk
Surface: Bonded Rubber Mulch



Finding: There is/are finger entrapment/s in the platform and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

Action: Monitor - No action given the risk assessment

i 6 - Low Risk (Finding 1)

Item: Other - Musical Instrument
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The area around the item has eroded and may become slippery

Action: Reinststate eroded area

i 6 - Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some wear to the shackles.

Action: Monitor for any further deterioration and replace when 40% worn

i 4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 1)

Item: Activity Equipment - Crawling Tunnel
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: This design / configuration of tunnel mound is well established and has been successfully included in large quantities of playgrounds throughout the UK. Whilst the design does not fully meet the requirements of BS EN 1176 with regards to falls in excess of 600mm over the edge of the tunnel to the surface below, it has been risk assessed as fit for purpose in this regard and no changes are recommended to the design unless otherwise stated in additional findings

Action: Monitor - No action given the risk assessment

i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Crawling Tunnel
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: The grass has eroded within the impact area of the equipment and may not provide the necessary impact attenuating properties for the equipment fall height; the surface may also be slippery in wet weather
Action: Reinstate the grass or provide an all weather surface

i 8 - Low Risk (Finding 3)

Item: Activity Equipment - Crawling Tunnel
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: There are projecting grass mat pins present
Action: Remove and provide more appropriate fixings if required

i 6 - Low Risk (Finding 4)

Item: Activity Equipment - Crawling Tunnel
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some evidence of fire damage to the item **Action:** Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 1)

Item: Other - Tree Trunk
Manufacturer: Natural Feature

Risk Level: L - Low Risk
Surface: Grass



Finding: The item has been removed leaving the foundations exposed **Action:** Remove the foundations and reinstate surface

 12 - Moderate Risk (Finding 2)

Item: Other - Tree Trunk
Manufacturer: Natural Feature

Risk Level: M - Moderate Risk
Surface: Grass



Finding: There are areas or parts of the timber on the structure that have rotted

Action: Replace all affected timbers

i 8 - Low Risk (Finding 1)

Item: Other - Embankment Slide
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: The surface has eroded and the foundations are exposed

Action: Reinstall surrounding surfaces to cover the foundations

i 10 - Low Risk (Finding 2)

Item: Other - Embankment Slide
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: There is moderate damage to the surface

Action: Repair the damaged areas of surfacing

i 8 - Low Risk (Finding 3)

Item: Other - Embankment Slide
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Grass



Finding: The grass mat surfacing has numerous stones present within the surface and will not perform as intended in relation to Head Injury Criterion testing

Action: Lift mats and ensure stones are removed and ground is suitable prior to re-laying

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: N - Risk Assessment not Undertaken
Surface: Bonded Rubber Mulch



Finding: We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment

Action: Inspect in accordance with the manufacturers recommendations

! 20 - High Risk (Finding 2)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: H - High Risk
Surface: Bonded Rubber Mulch



Finding: The item has been severely damaged

Action: Repair or replace the item / affected part

i 8 - Low Risk (Finding 3)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The seat is less than 2.0 metres from the post when extended at 45 degrees at the end of the area of travel and does not meet the requirements of BS EN 1176 Part 4

Action: Adjust the cable stop position to ensure the minimum distance is maintained

i 6 - Low Risk (Finding 4)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 0 - Risk Assessment not Undertaken (Finding 5)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: N - Risk Assessment not Undertaken
Surface: Bonded Rubber Mulch



Finding: The seat connection cannot be inspected without dismantling the seat

Action: Dismantle the seat to inspect the seat connection for wear

10 - Low Risk (Finding 6)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The grass has eroded within the impact area of the equipment and may not provide the necessary impact attenuating properties for the equipment fall height; the surface may also be slippery in wet weather
Action: Reinstate the grass or provide an all weather surface

6 - Low Risk (Finding 7)

Item: Other - Cable Runway
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Bonded Rubber Mulch



Finding: The unit is easily accessible and should have the appropriate barriers installed to meet the requirements of BS EN 1176 Part 1 as the height of the unit exceeds 600mm
Action: Monitor - No action given the risk assessment